

## Active Errata List

- During UART Reception, Clearing REN May Generate Unexpected IT
- SPI Interface - Transmission on Master Mode
- SPI Interface - SPI SS pin Limitation on Master/Slave
- SPI - SPI Slave Responding in a Multislave Configuration When Not Selected by the Master and its SPDAT Register Loaded
- SPI - SPI Slave Not Responding When Selected and Not Loaded
- ALE Disabled Toggles During Internal MOVX
- Timer 2 - Baud Rate Generator - No IT When TF2 is Set by Software
- Timer 2 - Baud Rate Generator - Long Start Time
- SPI Slave Mode/Data Corrupted
- 32 kHz Oscillator for AT83C51IC2/T80C51ID2 Needs External Feed Back Resistor
- RB8 Lost With JBC on SCON
- C51 Core – Bad Exit of Power-down in X2 Mode

## Errata History

Rev	Lot Number	1st Prod.	Trouble List
A	above 00395	Nov 2001	1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11

## Errata Descriptions

- 1. During UART Reception, Clearing REN May Generate Unexpected IT**

During UART reception, if the REN bit is cleared between a start bit detection and the end of reception, the UART will not discard the data (RI is set).

**Workaround**

Test REN at the beginning of Interrupt routine just after CLR RI, and run the Interrupt routine code only if REN is set.
- 2. SPI Interface - Transmission on Master Mode**

A 9th bit is transmitted by the interface when the clock rate is set on divide by 2 mode and a positive polarity is selected; the SPR2, SPR1, SPR0 bits are cleared (000) and CPOL = 1 on the SPCON register.

**Workaround**

Set the clock rate divide by 4 and X2 mode.
- 3. SPI Interface - SPI SS pin Limitation on Master/Slave**

The SS pin of the SPI does not return to an I/O when a One-to-One Master/Slave intercommunication is performed.

**Workaround**

No
- 4. SPI - SPI Slave Responding in a Multislave Configuration When Not Selected by the Master and its SPDAT Register Loaded**

In a multislave configuration, if the master is sending the Sck and the Tx data to all the slaves, and only one slave is selected, the non-selected slaves respond and generate the end of the transmission interruption (SPIF) if their SPDAT registers are loaded before the transmission.

**Workaround**

No



## 80C51 MCUs

AT83C51RB2  
AT83C51RC2  
AT83C51IC2  
AT80C51ID2  
Errata Sheet

4242A-8051-07/03



**5. SPI - SPI Slave Not Responding When Selected and Not Loaded**

SPI Slave does not respond when selected by a Master and no Data is loaded to be transmitted. No Rx data is registered and no SPIF interruption is generated at the end of the Transmission.

**Workaround**

No

**6. ALE Disabled Toggles During Internal MOVX**

When ALE is disabled, internal MOVX instruction shows toggle of ALE.

**Workaround**

No

**7. Timer 2 - Baud Rate Generator - No IT When TF2 is Set by Software**

When timer 2 is used in baud rate generator mode, setting TF2 by software doesn't generate an interrupt.

**Workaround**

Use timer 1 instead of timer 2 to generate baud rate and interrupt.

**8. Timer 2 - Baud Rate Generator - Long Start Time**

When timer 2 is used as baud rate generator, TH2 is not loaded with RCAP2H at the beginning, then UART is not operational before 10000 machine cycles.

**Workaround**

Add the initialisation of TH2 and TL2 in the initialisation of timer 2.

**9. SPI Slave Mode/Data Corrupted**

When SPI macro is configured in slave reception mode, the SPI block does not handle the good data on the SPI bus.

**Workaround**

No

**10. 32 kHz Oscillator for AT83C51IC2/T80C51ID2 Needs External Feed Back Resistor**

Internal feed back resistor is not connected, thus to start up, the 32 kHz Oscillator an external resistor is required.

**Workaround**

Connect between XTALB1 and XTALB2 a 2 MΩ resistor

**11. RB8 Lost With JBC on SCON**

On C51 when using JBC instruction on any bit of SCON register, if RB8 bit changes from "1" to "0" during JBC the "0" is lost and RB8 keeps "1".

**Workaround**

The workaround is to clear RB8.

In a polling algorithm you must clear RB8 at the beginning of the code and after each time it goes to "1".

Interrupt RB8 must be cleared at the beginning of the code and after each time it goes to "1".

---

## 12. C51 Core – Bad Exit of Power-down in X2 Mode

When exiting power-down mode by interrupt while CPU is in X2 mode, it leads to bad execution of the first instruction run when CPU restarts.

### **Workaround**

Set the CPU in X1 mode directly before entering power-down mode.



## Atmel Corporation

2325 Orchard Parkway  
San Jose, CA 95131  
Tel: 1(408) 441-0311  
Fax: 1(408) 487-2600

## Regional Headquarters

### Europe

Atmel Sarl  
Route des Arsenaux 41  
Case Postale 80  
CH-1705 Fribourg  
Switzerland  
Tel: (41) 26-426-5555  
Fax: (41) 26-426-5500

### Asia

Room 1219  
Chinachem Golden Plaza  
77 Mody Road Tsimshatsui  
East Kowloon  
Hong Kong  
Tel: (852) 2721-9778  
Fax: (852) 2722-1369

### Japan

9F, Tonetsu Shinkawa Bldg.  
1-24-8 Shinkawa  
Chuo-ku, Tokyo 104-0033  
Japan  
Tel: (81) 3-3523-3551  
Fax: (81) 3-3523-7581

## Atmel Operations

### Memory

2325 Orchard Parkway  
San Jose, CA 95131  
Tel: 1(408) 441-0311  
Fax: 1(408) 436-4314

### Microcontrollers

2325 Orchard Parkway  
San Jose, CA 95131  
Tel: 1(408) 441-0311  
Fax: 1(408) 436-4314

La Chantrerie  
BP 70602  
44306 Nantes Cedex 3, France  
Tel: (33) 2-40-18-18-18  
Fax: (33) 2-40-18-19-60

### ASIC/ASSP/Smart Cards

Zone Industrielle  
13106 Rousset Cedex, France  
Tel: (33) 4-42-53-60-00  
Fax: (33) 4-42-53-60-01

1150 East Cheyenne Mtn. Blvd.  
Colorado Springs, CO 80906  
Tel: 1(719) 576-3300  
Fax: 1(719) 540-1759

Scottish Enterprise Technology Park  
Maxwell Building  
East Kilbride G75 0QR, Scotland  
Tel: (44) 1355-803-000  
Fax: (44) 1355-242-743

### RF/Automotive

Theresienstrasse 2  
Postfach 3535  
74025 Heilbronn, Germany  
Tel: (49) 71-31-67-0  
Fax: (49) 71-31-67-2340

1150 East Cheyenne Mtn. Blvd.  
Colorado Springs, CO 80906  
Tel: 1(719) 576-3300  
Fax: 1(719) 540-1759

### Biometrics/Imaging/Hi-Rel MPU/ High Speed Converters/RF Datacom

Avenue de Rochepleine  
BP 123  
38521 Saint-Egreve Cedex, France  
Tel: (33) 4-76-58-30-00  
Fax: (33) 4-76-58-34-80

---

### e-mail

[literature@atmel.com](mailto:literature@atmel.com)

### Web Site

<http://www.atmel.com>

**Disclaimer:** Atmel Corporation makes no warranty for the use of its products, other than those expressly contained in the Company's standard warranty which is detailed in Atmel's Terms and Conditions located on the Company's web site. The Company assumes no responsibility for any errors which may appear in this document, reserves the right to change devices or specifications detailed herein at any time without notice, and does not make any commitment to update the information contained herein. No licenses to patents or other intellectual property of Atmel are granted by the Company in connection with the sale of Atmel products, expressly or by implication. Atmel's products are not authorized for use as critical components in life support devices or systems.

© Atmel Corporation 2003. All rights reserved. Atmel® and combinations thereof are the registered trademarks of Atmel Corporation or its subsidiaries.



Printed on recycled paper.