Designer's™ Data Sheet
SWITCHMODE™
Ultrafast Power Rectifier

MURP20040CT

ULTRAFAST RECTIFIER 200 AMPERES

POWERTAP™ II Package

Features mesa epitaxial construction with glass passivation. Ideally suited high frequency switching power supplies; free wheeling diodes and polarity protection diodes.

- Stable, High Temperature, Glass Passivated Junction
- Monolithic Dual Die Construction. May be Paralleled for High Current Output

Mechanical Characteristics:

- Case: Molded Epoxy with Metal Heatsink Base
- Weight: 80 grams (approximately)
- Finish: All External Surfaces Corrosion Resistant
- Base Plate Torques: See procedure given in the Package Outline Section
- Shipped 25 units per tray
- Marking: URP20040CT

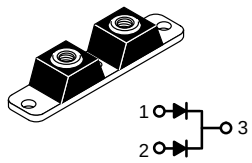

CASE 357C–03
POWERTAP II

MAXIMUM RATINGS

Rating		Symbol	Value	Unit
Peak Repetitive Reverse Voltage Working Peak Reverse Voltage DC Blocking Voltage		V_{RRM} V_{RWM} V_R	400	Volts
Average Rectified Forward Current (At Rated V_R, T_C = 115°C)	Per Leg Per Package	I_O	100 200	Amps
Peak Repetitive Forward Current (At Rated V_R, Square Wave, 20 kHz, T_C = 115°C)	Per Leg	I_{FRM}	200	Amps
Non-Repetitive Peak Surge Current (Surge applied at rated load conditions, halfwave, single phase, 60 Hz)	Per Package	I_{FSM}	800	Amps
Storage/Operating Case Temperature		T_{stg}, T_C	–55 to +150	°C
Operating Junction Temperature		T_J	–55 to +175	°C

THERMAL CHARACTERISTICS

Thermal Resistance — Junction–to–Case	Per Leg	R_{tjc}	0.5	°C/W

ELECTRICAL CHARACTERISTICS

Maximum Instantaneous Forward Voltage (1), see Figure 2 (I_F = 100 A) (I_F = 200 A)	Per Leg	V_F	T_J = 25°C 1.3 1.5	T_J = 100°C 1.2 1.4	Volts
Maximum Instantaneous Reverse Current, see Figure 4 (V_R = 400 V) (V_R = 200 V)	Per Leg	I_R	T_J = 25°C 5.0 0.8	T_J = 100°C 193 61	μA
Typical Reverse Recovery Time (2) (I_F = 1.0 A, di/dt = 50 A/μs)	Per Leg	T_{RR}	T_J = 25°C 85		ns
Typical Peak Reverse Recovery Current (I_F = 1.0 A, di/dt = 50 A/μs)	Per Leg	I_{RM}	T_J = 25°C –3.0		Amps

(1) Pulse Test: Pulse Width ≤ 250 μs, Duty Cycle ≤ 2%.
(2) T_{RR} measured projecting from 25% of IRM to ground.

POWERTAP and SWITCHMODE are trademarks of Motorola, Inc.

This document contains information on a product under development. Motorola reserves the right to change or discontinue this product without notice.

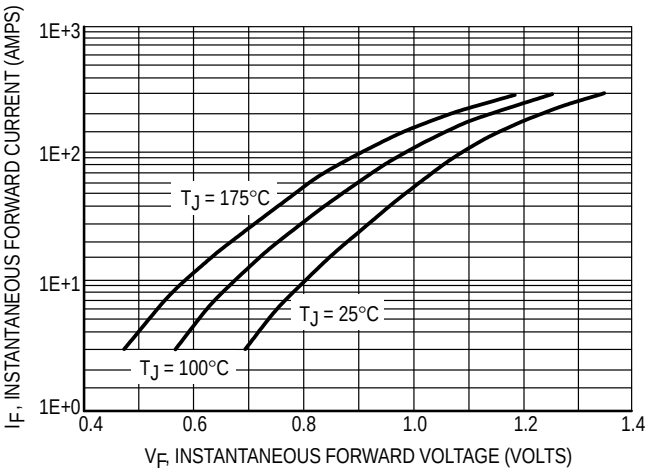

Figure 1. Typical Forward Voltage

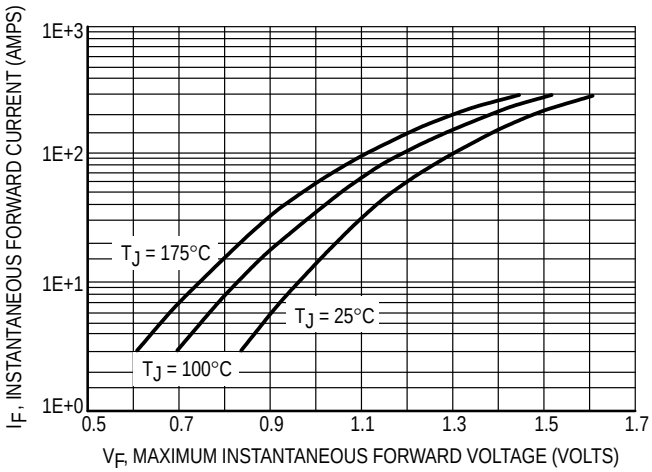

Figure 2. Maximum Forward Voltage

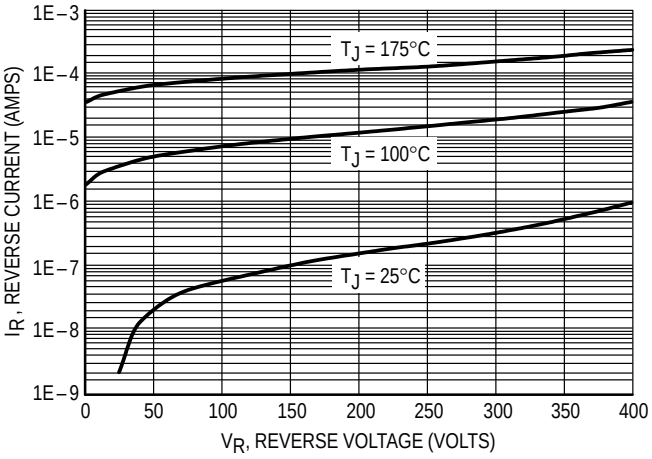

Figure 3. Typical Reverse Current

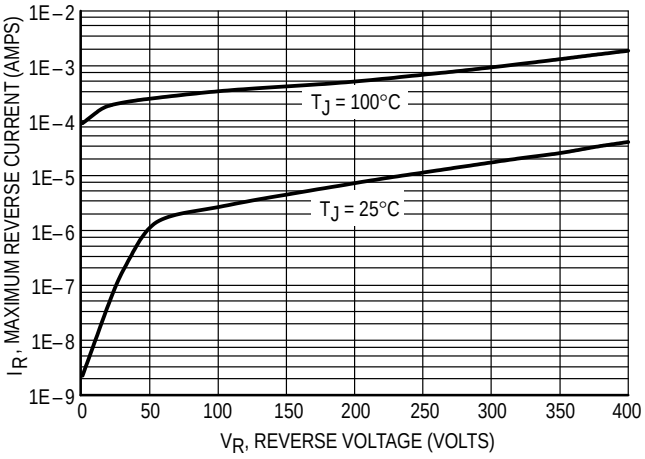

Figure 4. Maximum Reverse Current

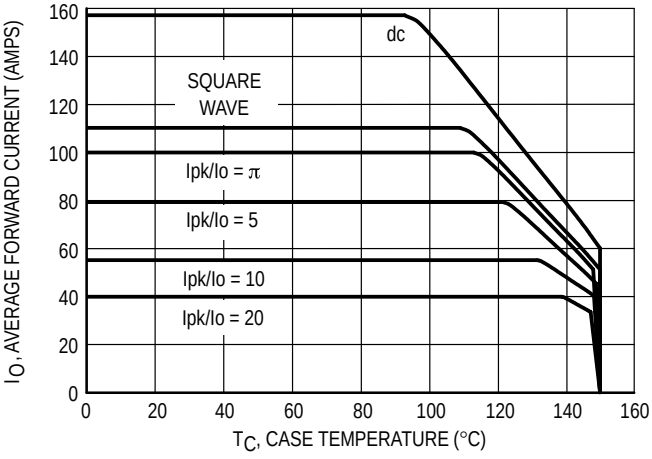

Figure 5. Current Derating (PER LEG)

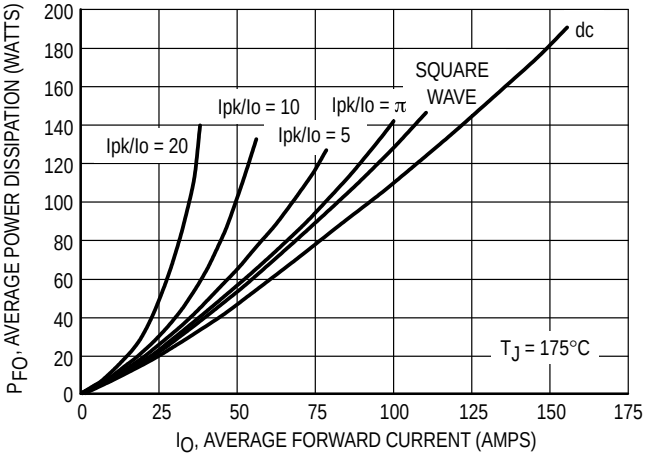

Figure 6. Forward Power Dissipation (PER LEG)

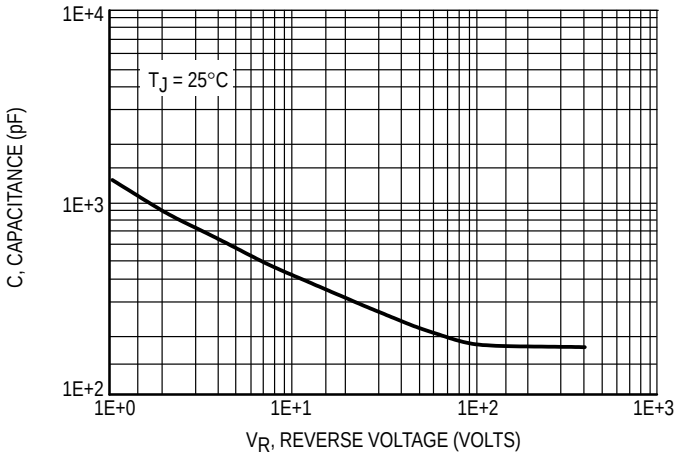

Figure 7. Capacitance

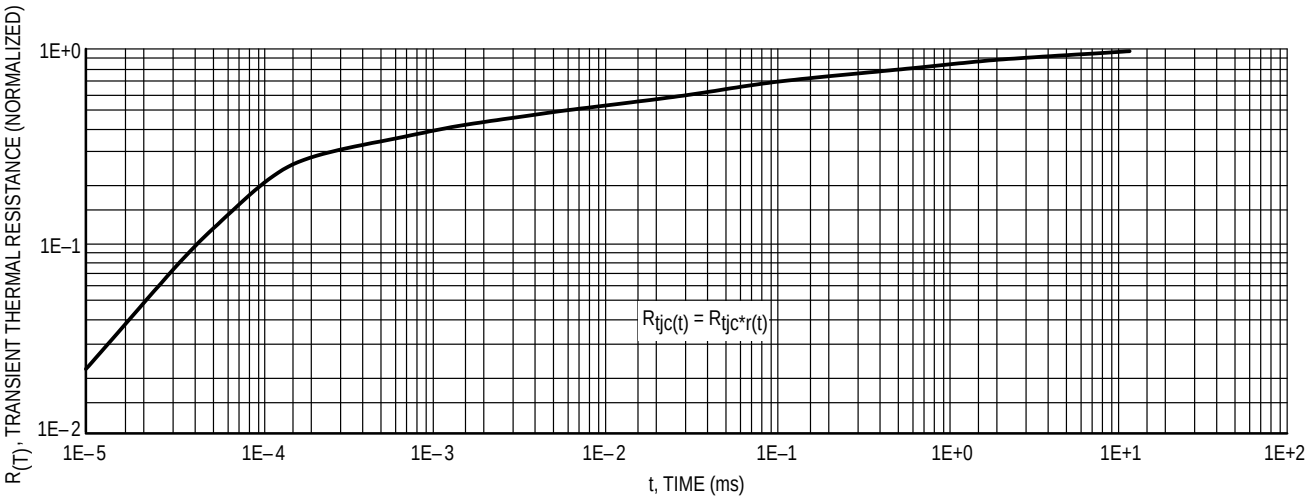

Figure 8. Thermal Response

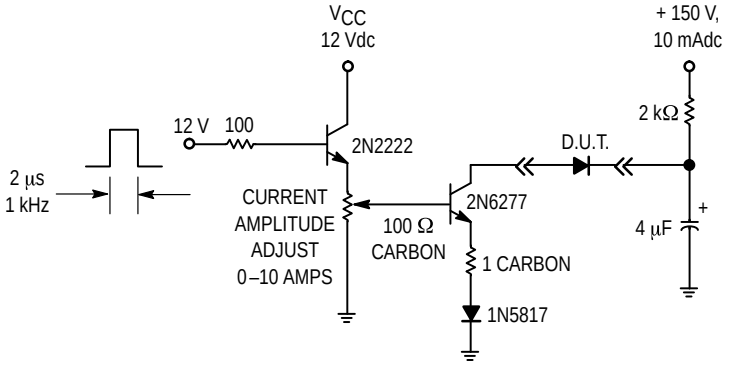

Figure 9. Test Circuit for Repetitive Reverse Current

MAXIMUM MECHANICAL RATINGS

Terminal Penetration:	0.235 max
Terminal Torque:	70 in-lb max
Mounting Torque — Outside Holes:	70 in-lb max
Mounting Torque — Center Hole:	8–10 in-lb max
Seating Plane Flatness	1 mil per in. (between mounting holes)

POWERTAP MECHANICAL DATA
APPLIES OVER OPERATING TEMPERATURE



Vertical Pull
250 lbs. max

2 in. Lever Pull
50 lbs. max

Note: While the POWERTAP is capable of sustaining these vertical and levered tensions, the intimate contact between POWERTAP and heat sink may be lost. This could lead to thermal runaway. The use of very flexible leads is recommended for the anode connections. Use of thermal grease is highly recommended.

MOUNTING PROCEDURE

The POWERTAP package requires special mounting considerations because of the long longitudinal axis of the copper heat sink. It is important to follow the proper tightening sequence to avoid warping the heat sink, which can reduce thermal contact between the POWERTAP and heat sink.

STEP 1:
Locate the POWERTAP on the heat sink and start mounting bolts into the threads by hand (2 or 3 turns).

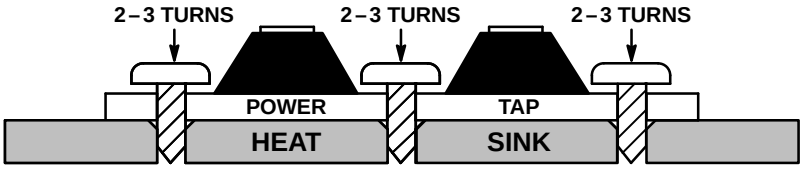

STEP 2:
Finger tighten the center bolt. The bolt may catch on the threads of the heat sink so it is important to make sure the face of the bolt or washer is in contact with the surface of the POWERTAP.

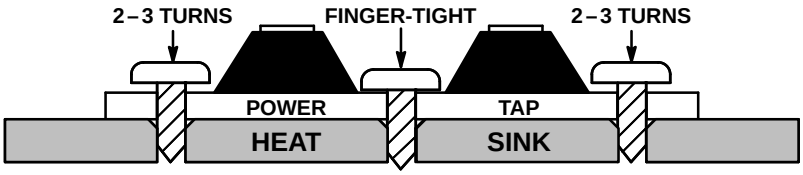

STEP 3:
Tighten each of the end bolts between 5 to 10 in-lb.

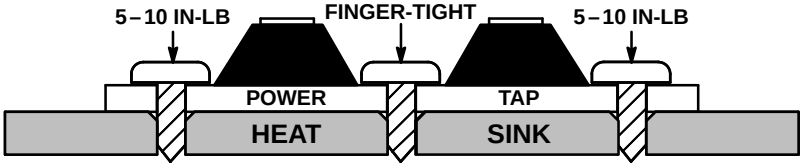

STEP 4:
Tighten the center bolt between 8 to 10 in-lb.

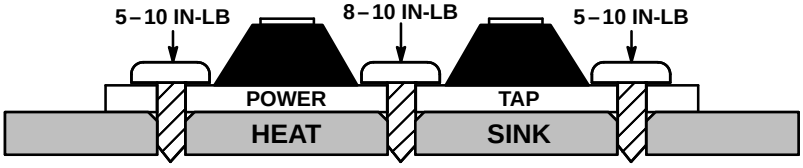

STEP 5:
Finally, tighten the end bolts to 70 in-lb.

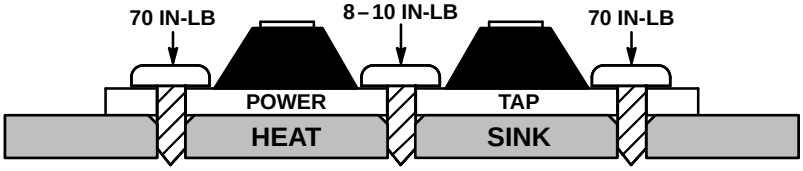

PACKAGE DIMENSIONS

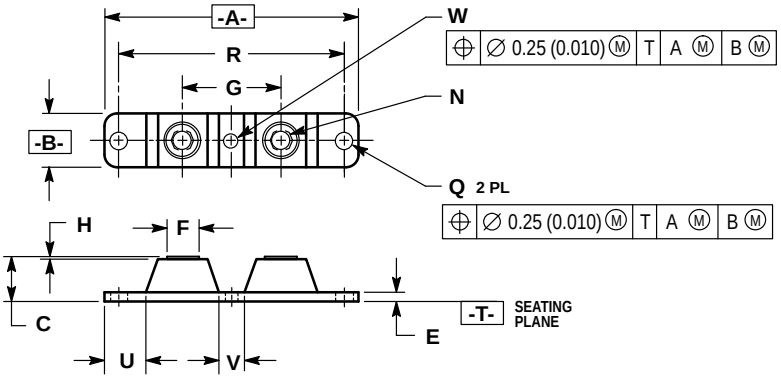

NOTES:
1. DIMENSIONING AND TOLERANCING PER ANSI Y14.5M, 1982.
2. CONTROLLING DIMENSION: INCH.
3. TERMINAL PENETRATION: 5.97 (0.235) MAXIMUM.

	INCHES		MILLIMETERS	
DIM	MIN	MAX	MIN	MAX
A	3.450	3.635	87.63	92.33
B	0.700	0.810	17.78	20.57
C	0.615	0.640	15.53	16.26
E	0.120	0.130	3.05	3.30
F	0.435	0.445	11.05	11.30
G	1.370	1.380	34.80	35.05
H	0.007	0.030	0.18	0.76
N	1/4–20UNC 2B		1/4–20UNC 2B	
Q	0.270	0.285	6.86	7.32
R	31.50 BSC		80.01 BSC	
U	0.600	0.630	15.24	16.00
V	0.330	0.375	8.39	9.52
W	0.170	0.190	4.32	4.82

CASE 357C–03
ISSUE C

How to reach us:
USA / EUROPE: Motorola Literature Distribution;
P.O. Box 20912; Phoenix, Arizona 85036. 1–800–441–2447

MFAX: RMFAX0@email.sps.mot.com – TOUCHTONE (602) 244–6609
INTERNET: http://Design–NET.com

JAPAN: Nippon Motorola Ltd.; Tatsumi–SPD–JLDC, Toshikatsu Otsuki,
6F Seibu–Butsuryu–Center, 3–14–2 Tatsumi Koto–Ku, Tokyo 135, Japan. 03–3521–8315

HONG KONG: Motorola Semiconductors H.K. Ltd.; 8B Tai Ping Industrial Park,
51 Ting Kok Road, Tai Po, N.T., Hong Kong. 852–26629298