



Typ 1

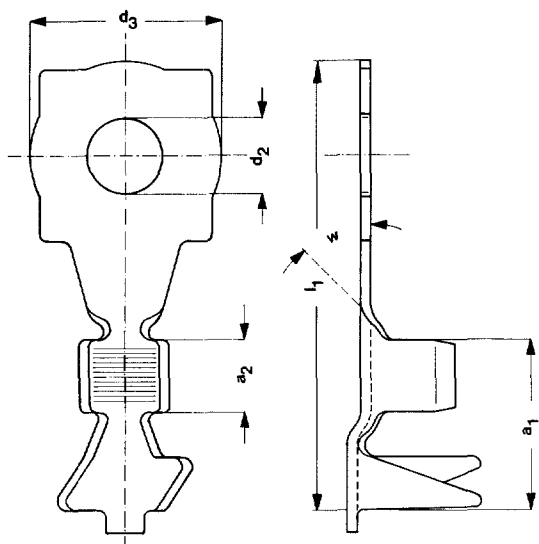

Typ 2

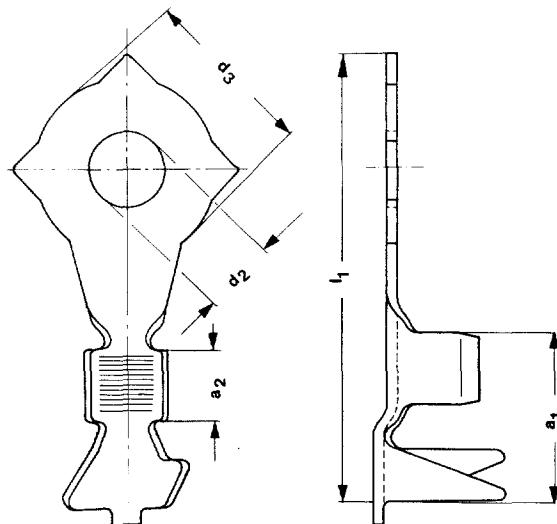

Typ	Nenn- quer- schnitt gmm	a1	a2	d2	d3	L1	w"	Mat.- dicke	Form E=Einzel B=Band	Teile-Nr.	Werkstoff	Oberfläche	Verb.- vor- schub
1	10 - 16	19,00	8,00	8,40	21,00	50,00	45	1,20	E	02249.111.170	CuZn	fSn 10	
									E	02249.111.178	CuZn	frSn 2	
									E	02249.201.178	CuSn	frSn 2	
1	10 - 16	19,00	8,00	8,40	21,00	50,00	90	1,20	E	02252.201.178	CuSn	frSn 2	
1	10 - 16	19,00	8,00	8,40	21,00	50,00		1,20	B	26837.111.170	CuZn	fSn 10	NQ
									B	26837.111.178	CuZn	frSn 2	
									B	26837.201.178	CuSn	frSn 2	
									E	06837.111.170	CuZn	fSn 10	
									E	06837.111.178	CuZn	frSn 2	
2	10 - 16	19,00	8,00	8,40	21,00	52,60		1,20	B	26838.111.170	CuZn	fSn 10	NQ
									B	26838.111.178	CuZn	frSn 2	
									E	06838.111.170	CuZn	fSn 10	

30000,003