-	
p.	1/5
1.	1/J

Spec No.	SS-021	
Data	Oct 30, 2003	
Version	First	

SPECIFICATION


Product name :Rodan Spark Gap

Туре

:RSG-102-BJL



OKAYA ELECTRIC AMERICA, INC.

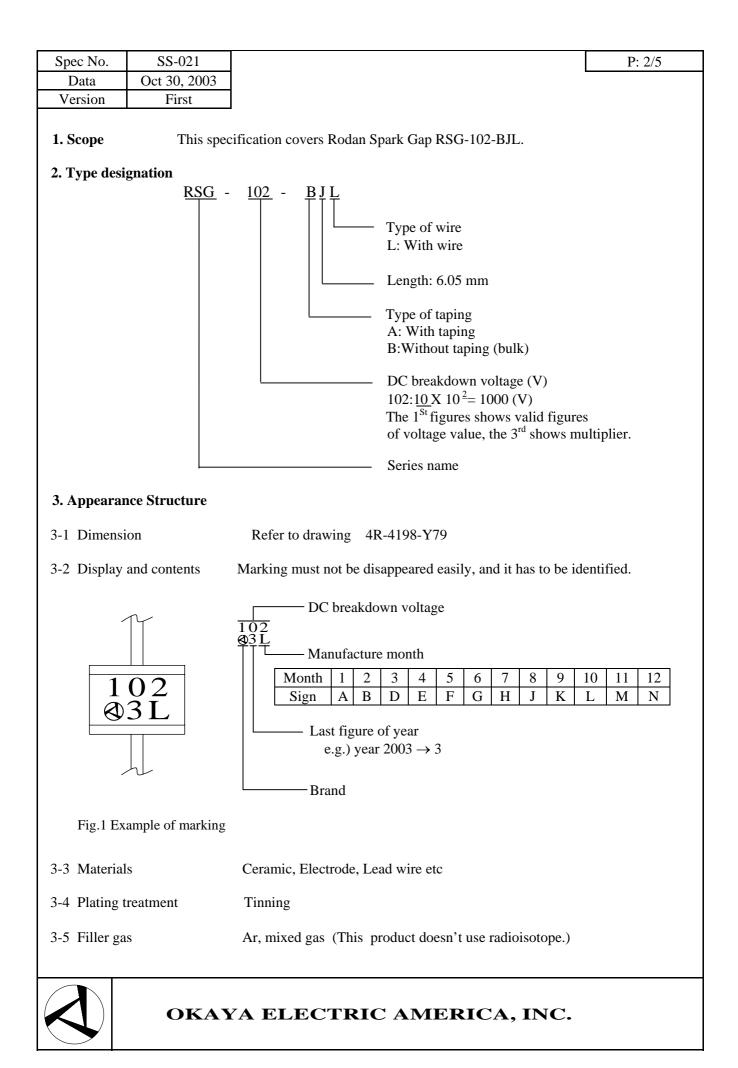

Spec No.	SS-021
Data	Oct 30, 2003
Version	First

4. Electrical characteristics

No.	Item	Mark	Т	est condition	Standard values
		Switching times	1 s Max		
		Ambient temperature	Room temperature		
1	1 DC breakdown Ez Voltage	Ez	Test circuit $R=400k\Omega$ $L=0.5\mu H$ $C=0.002\mu E$		1000 V ±15 %
	$V_0 = 1400 \text{ V}$ $C = 0.022 \mu \text{ F}$ (sc)				
2	Insulation resistance	IR	DC100 V		1000 MΩ Min
3	Electrostatic capacitance	C	1.0 kHz		2.0 pF Max
		Switching frequency	30Hz		
			Switching times	2.5 s ON / 57.5 s OFF	Initial breakdown
4 Life test –	Ambient temperature	Room temperature	voltage 1390 V Max		
	Test circuit		Following breakdown		
	_		R L=0.7 μ H 75 nF 6° (osc) *R is adjusted	voltage 1000 V ±15 % Insulation resistance 100 MΩ Min (DC100 V)	
			Minimum number according to the a	r of switching is 2×10^5 times, bove condition.	

*1 The above-mentioned electric characteristics are regulations of during darkness.

*2 This product may discharge less than 850 V that is lower limit of specification. This case is known as early ignition. Early ignition incidence is specified as maximum of 3 % by above test condition of section1 and section4.



OKAYA ELECTRIC AMERICA, INC.

Spec No.	SS-021
Data	Oct 30, 2003
Version	First

5. Switching frequency

Maximum switching frequency : 200 Hz

6. Operating condition

Operating temperature: -40C to +100C


7. Storage condition

Storage temperature: -40C to +100C

8. About forming

As regards forming of spark gap, please take distance more than 2mm from main body when you bend lead wire.

When performing a forming, please hold only lead wire and be careful not to give a stress on main body.

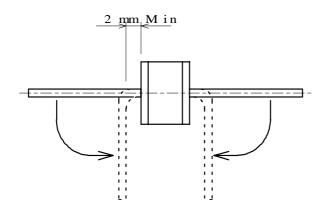




Spec No.	SS-021	
Data	Oct 30, 2003	
Version	First	

9. Packing

Put 50 pcs. of RSG series and 1pc. of product label in a vinyl bag of specified size, seal the bag with a heatseal, put bags of quantity required a box, pack and stick product label on the box.

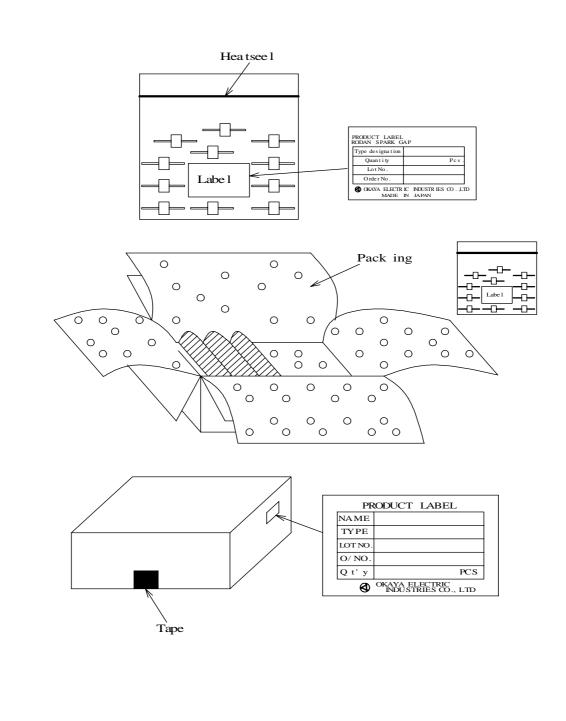

P: 5/5

