






STR. MALE MODULE 4 SOLDER TYPE INSERTS**3 MM FOR PCB****R694.251.026**

Series : MCC2

4 Coax Position AB/1A,1C

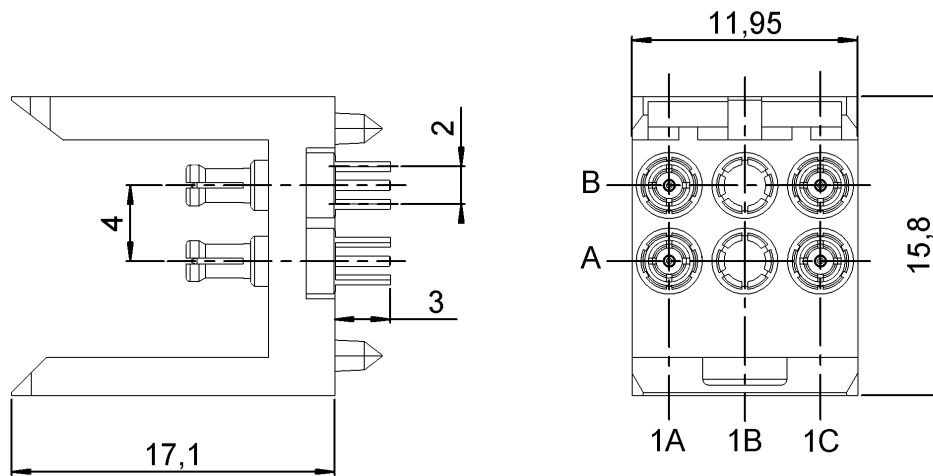

Connectors' packaging

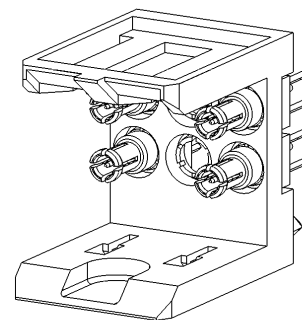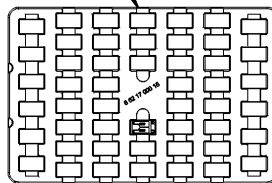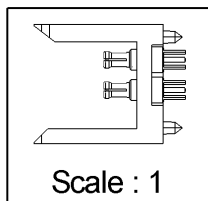

All dimensions are in mm.

COMPONENTS	MATERIALS	PLATING (μm)
BODY	BRONZE	NPGR
CENTER CONTACT	BRASS	NPGR
OUTER CONTACT	BRONZE	NPGR
INSULATOR	PTFE	
GASKET	-	-
OTHERS PARTS	LIQUID CRISTAL POLYMER	-
-	-	-
-	-	-

Issue : 0624 C

In the effort to improve our products, we reserve the right to make changes judged to be necessary.



STR. MALE MODULE 4 SOLDER TYPE INSERTS**3 MM FOR PCB****R694.251.026**

Series : MCC2

PACKAGING

Standard	Unit	Other
50	'W' option	Contact us

SPECIFICATION**ELECTRICAL CHARACTERISTICS**

Impedance	50	Ω
Frequency	0-6	GHz
VSWR	1.12 + 0,0000	x F(GHz) Maxi
Insertion loss	0.2	$\sqrt{F}(\text{GHz})$ dB Maxi
RF leakage	- (	- F(GHz)) dB Maxi
Voltage rating	500	Veff Maxi
Dielectric withstanding voltage	750	Veff mini
Insulation resistance	5000	M Ω mini

ENVIRONMENTAL

Operating temperature	-25/+125	$^{\circ}\text{C}$
Hermetic seal	NA	Atm.cm3/s
Panel leakage	NA	

OTHER CHARACTERISTICS

Assembly instruction

Others :

VSWR=1.12 optimized between DC to 3GHz

MECHANICAL CHARACTERISTICS

Center contact retention	
Axial force – Mating end	6 N mini
Axial force – Opposite end	6 N mini
Torque	NA N.cm mini
Recommended torque	
Mating	NA N.cm
Panel nut	NA N.cm
Mating life	500 Cycles mini
Weight	97,8400 g


Issue : 0624 C

In the effort to improve our products, we reserve the right to make changes judged to be necessary.



R694.251.026

3 MM FOR PCB

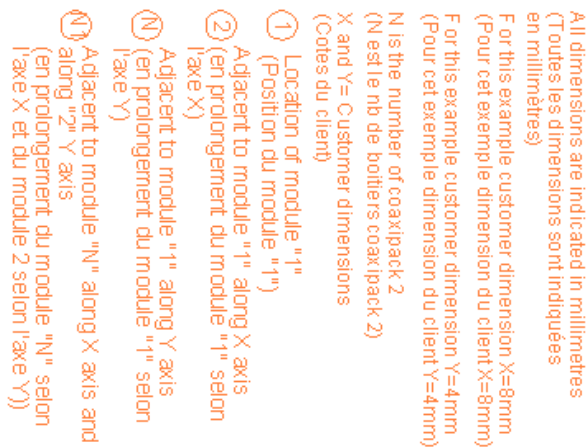


In the effort to improve our products, we reserve the right to make changes judged to be necessary.




STR. MALE MODULE 4 SOLDER TYPE INSERTS**3 MM FOR PCB****R694.251.026**

Series : MCC2

- Place the coax connector(s) on the PCB

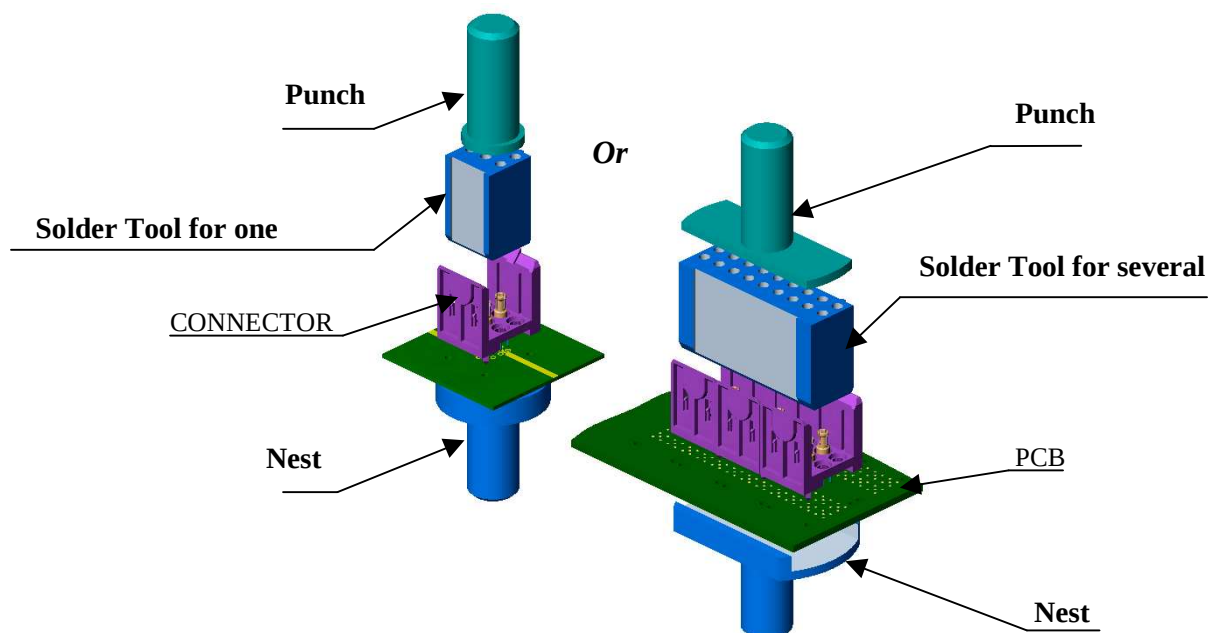

- Place correctly the PCB between the punch and the nest of the press.
- In case of multiple housing configuration , use a punch and a nest large enough to cover all the housings.
- Ensure solder legs are properly aligned with the holes before press-mounting.
- Press on the housing(s) with the punch until the complete insertion of the fixing stud into the PCB.

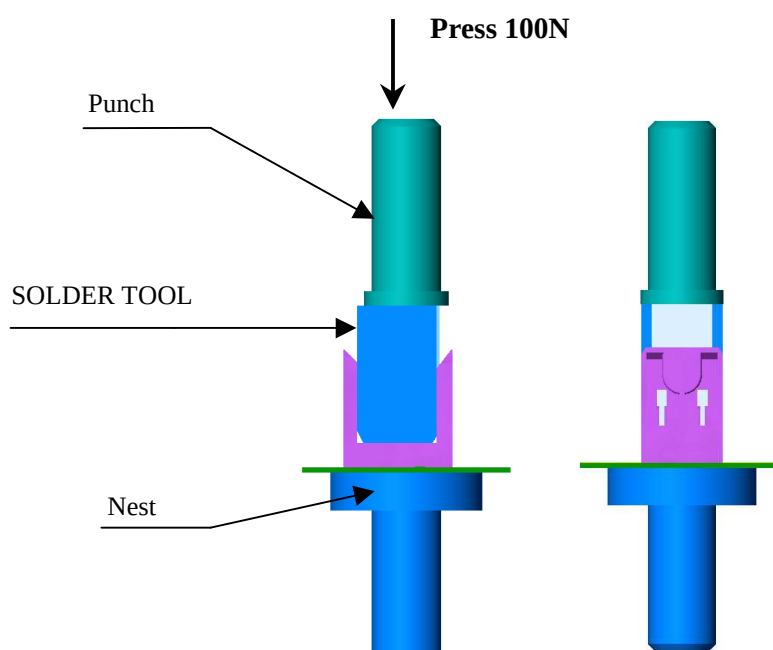
**Issue : 0624 C**

In the effort to improve our products, we reserve the right to make changes judged to be necessary.


STR. MALE MODULE 4 SOLDER TYPE INSERTS**3 MM FOR PCB****R694.251.026**

Series : MCC2

- After the insertion of the connectors on the printed circuit , leave the solder tool inserted in position.
- Solder the legs on board

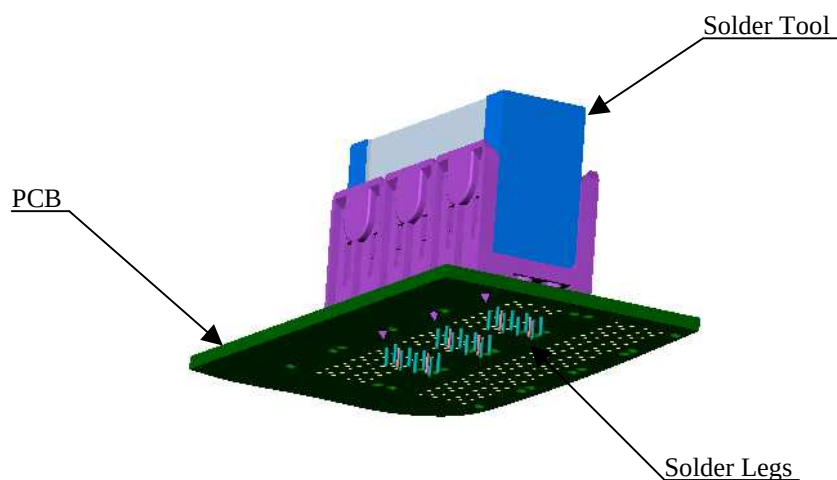

- After the solder legs have been soldered , using an appropriate soldering process , remove the solder tool.

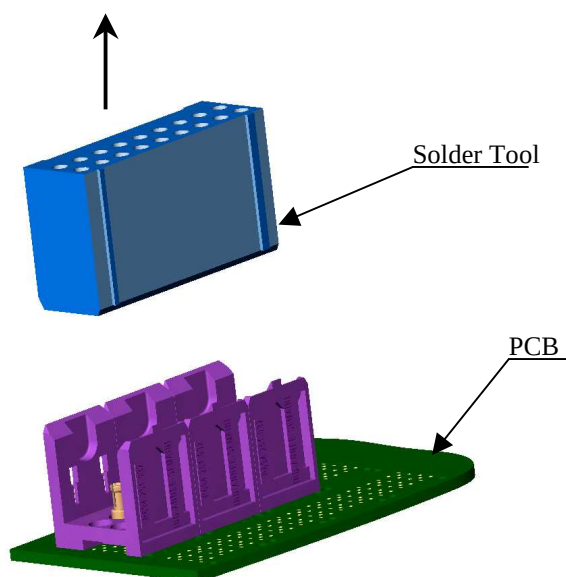

Radiall do not recommend to use more than 3 modules on the same motherboard and can't be held liable of any connection defect when more than 3 modules are implemented on the board.

Issue : 0624 C

In the effort to improve our products, we reserve the right to make changes judged to be necessary.

